

$$r \text{ (mm)} = 25 - 100$$

$$h_1 \text{ (mm)} = 20 - 60$$

$$H \text{ (mm)} = h_1 + r + t$$


$$D_p \text{ (mm)} \approx D + r + 1,7h_1$$

(Pul Çapı / Disk Diameter)

$$V \text{ (mm}^3\text{)} \approx 0,78D^2r - 0,66Dr^2 (h_1 = 0)$$

$$m \text{ (kg)} = 2\pi Dp^2t$$

(Dp birimi (m) / t birimi (mm))

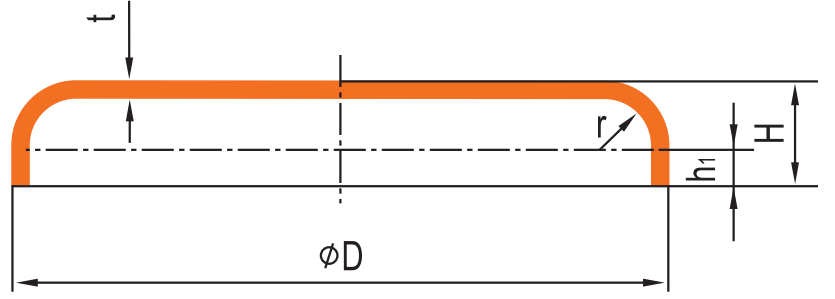

D (mm)	t (mm)	Dp (mm)	r (mm)	V (dm ³)	m (kg/mm)
300	3--12	360	25	1,6	0,8
400	3--14	460	25	3,0	1,3
500	3--16	570	30	4,7	2,0
600	3--16	670	30	6,8	2,8
700	3--16	770	30	9,3	3,7
800	3--22	870	30	15	4,8
900	3--22	970	30	19	5,9
1000	3--22	1070	30	23	7,2
1100	3--25	1180	35	33	8,7
1200	3--25	1280	35	39	10
1300	3--25	1380	35	46	12
1400	3--25	1490	40	53	14
1500	4--25	1590	40	69	16
1600	4--35	1690	40	79	18
1700	4--35	1800	45	89	20
1800	4--35	1900	45	100	22
1900	4--35	2020	50	125	26
2000	5--35	2120	50	139	28
2100	5--40	2220	50	152	31
2200	5--40	2320	50	168	34
2300	5--40	2420	50	204	37
2400	5--40	2520	50	222	40
2500	5--40	2620	50	240	43
2600	6--40	2720	50	260	46
2700	6--40	2820	50	281	50
2800	6--40	2920	50	303	54
2900	6--40	3020	50	325	57
3000	6--40	3120	50	348	61
3100	6--40	3220	50	372	65
3200	6--40	3320	50	397	69
3300	6--40	3420	50	422	74
3400	6--40	3520	50	448	78
3500	6--40	3620	50	475	82

D (mm)	t (mm)	Dp (mm)	r (mm)	V (dm ³)	m (kg/mm)
3600	8--40	3720	50	503	87
3700	8--40	3820	50	532	92
3800	8--40	3920	50	561	97
3900	8--40	4020	50	591	102
4000	8--40	4120	50	622	107
4100	8--40	4250	75	980	113
4200	8--40	4350	75	1025	119
4300	8--40	4450	75	1075	124
4400	8--40	4550	75	1124	130
4500	10--50	4650	75	1176	136
4600	10--50	4750	75	1230	142
4700	10--50	4850	75	1284	148
4800	10--50	4950	75	1340	154
4900	10--50	5050	75	1396	160
5000	10--50	5200	100	1930	170
5100	10--50	5300	100	2009	177
5200	10--50	5400	100	2090	183
5300	10--50	5500	100	2171	190
5400	10--50	5600	100	2255	197
5500	10--50	5700	100	2340	204
5600	10--50	5800	100	2441	211
5700	10--50	5900	100	2529	218
5800	10--50	6000	100	2619	226
5900	10--50	6100	100	2710	233
6000	10--50	6200	100	2802	241
6100	10--50	6300	100	2862	249
6200	10--50	6400	100	2957	257
6300	10--50	6500	100	3054	265
6400	10--50	6600	100	3152	274
6500	10--50	6700	100	3252	282
6600	10--50	6800	100	3354	291
6800	10--50	7000	100	3562	308
7000	10--50	7200	100	3775	326